Notice Sheet 13
Ford Ranger/ Mazda BT50 Clutch Damper

Important Information

The hydraulic clutch damper located on the firewall (circled in the image below) can perish over time and close inspection of the damper is required at the time of clutch fitment.
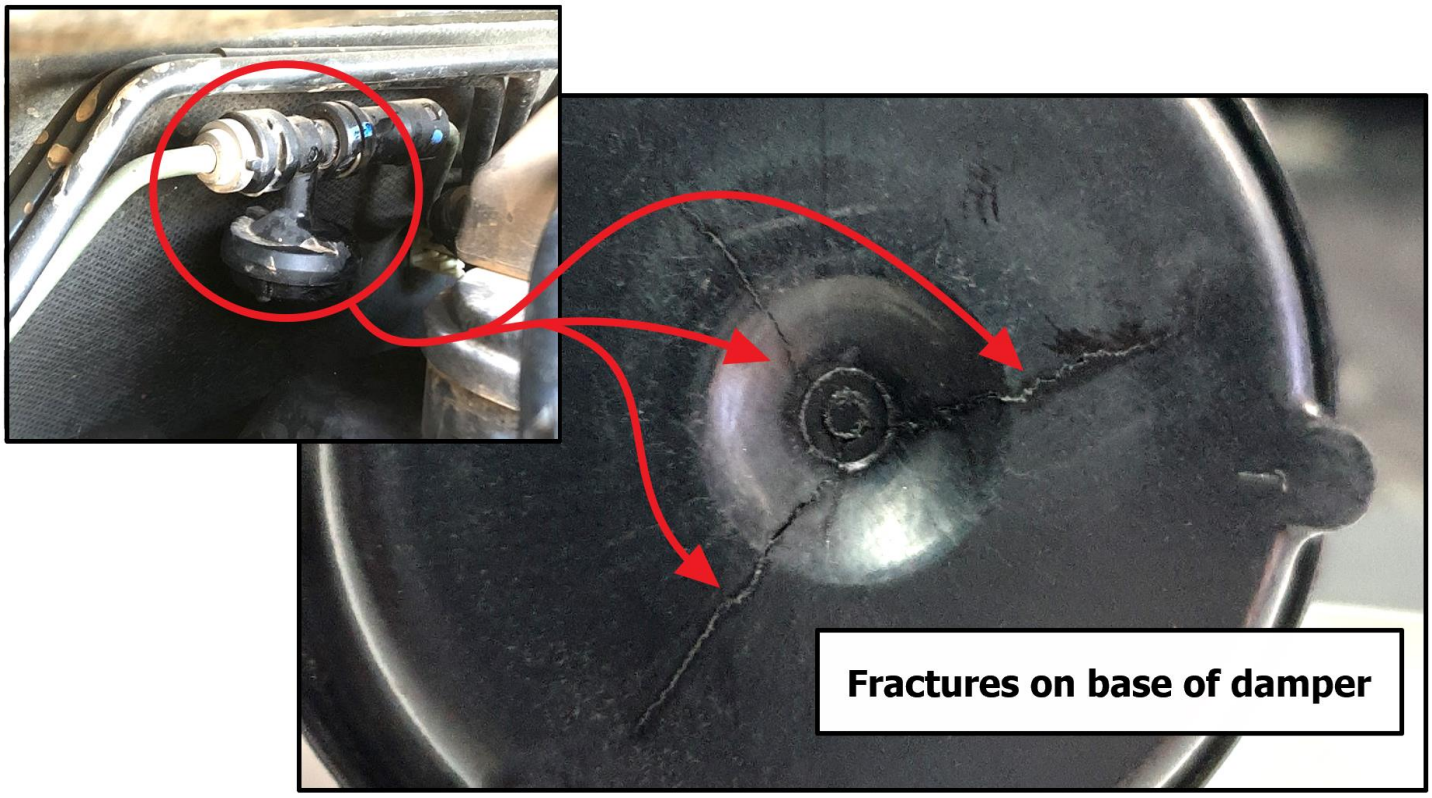
Failure to identify or replace faulty clutch damper may result in loss of pedal pressure and/or difficult gear selection.